



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D412-742-043
Job Sheet 161820



Part No: D412-742-043

Job Qty: 1 ea

Part Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.



5002166

Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 9/30/17

Job Tracking No:

Due Date: 12/1/17

Created By: Mario Poulin

Type: Stock

Description:

Note: DWG REV J SHEETS 1,2 IPP Rev A 05.10.13 New Issue KJ/JLM IPP Rev 06.02.13 ECN 773 dwg @ rev.D
EC IPP Rev:C 07-05-28 As per Rev F JLM IPP Rev:D 07-12-04 ECN 1072 DD verified by:JLM IPP Rev:E 08-
09-08 ecn 08-510 DD verified by:EC IPP Rev:F 11.11.01 as per DSI9517 REV.B DD verified by:EC IPP REV:G
16.05.02 AS PER DWG REV.J DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Due Date	Standard		Workcenter/Supplier	
				Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	1 Ea	11/30/17	0.00	0.00	Start up container	
100	DC	1 pcs	11/30/17	0.00	0.00	DC	
110	HandFinish	1 pcs	12/1/17	0.00	3.50	HandFinish4	
120	QC	1 pcs	12/1/17	0.00	0.00	QC5	
130	Packaging	1 pcs	12/1/17	0.00	0.00	Packaging3	
140	QC21-FG	1 Ea	12/1/17	0.00	0.00	QC21	

Part Op 100 - If D412-742-043 is a W/O on it's own, Photocopy bluefile and create labels per PPP D412-742-043 CHG007
Descriptions: 110 - 1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins. A/R Sikaflex-241/-291 _____ Expiry date: _____
2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex. A/R Sikaflex-241/-291 _____ Expiry date: _____ 3-Remove "T" pins once sikaflex is dry.
4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser. A/R LPS Procyon _____
VERIFY FWD AND AFT SADDLE FIT DURING ASSEMBLY BY: _____
DATE: _____
130 - Identify and pack for shipping as per PPP D412-742-043 Location: _____ PPP Rev: _____

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	AN3C4A 5001621	24	1,980	0	0
	AN3C6A 5002009	4	100	0	0
	AN5C7A 5002010	10	97	0	0
	D3391-021 5001287	1	1	0	0
	D3391-023 5001372	1	0	0	0
	D3391-025 5001815	1	3	0	0
	D4095-041 5002020	1	14	0	0
	D4095-043 5002021	1	6	0	0
	D4095-045 5002022	1	10	0	0
	NAS1149C0332R 5002023	28	2,674	0	0
	NAS1149C0532R 5002024	10	239	0	0

Part Specifications

DART
AEROSPACE

S002166



Repl. Skidtube Fits LH or RH, High Gear, DART (Apical)
Tri-Bag Float Comp.

PART NO:

D412-742-043

Revision:

Packaging

Operation:

1

Quantity:

Change No:

Dart Aerospace Ltd.

1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Mfg Date: 10/25/17
Job No: 161820

Work Order ID 161820

Tuesday, May 23, 2017 10:55:34 AM

161820

Page 1

Item ID: D412-742-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/15/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: 

Date:

MAY 23 2017

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

J

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

If D412-742-043 is a W/O on it's own,
Photocopy bluefile and create labels per PPP D412-742-043 CHG007

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 161820

Tuesday, May 23, 2017 10:55:34 AM

161820

Page 2

Item ID: D412-742-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/15/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

110

Assemble as per dwg

0.00

110

HandFinishing

HandFinish

Memo

1.89

Hand Finishing

1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins.
A/RSikaflex-241/-291 _____
Expiry date: _____

2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex.

A/RSikaflex-241/-291 _____
Expiry date: _____

3-Remove "T" pins once sikaflex is dry.

4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser.
A/RLPS Procyon _____

VERIFY FWD AND AFT SADDLE FIT DURING ASSEMBLY

BY: _____

DATE: _____

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

161820

Page 3

N900040100

Setup Start *NS1*

Stop *NS2*

Stop *NS2*

1

1

Run Start *NR1*

Stop ***NR2***

Stop ***NR2***

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Picklist Print

Tuesday, May 23, 2017 10:55:30 AM

Page 1

Work Order ID: 161820

161820

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev A 05.10.13 New Issue KJ/JLM
 IPP Rev 06.02.13 ECN 773 dwg @ rev.D EC
 IPP Rev:C 07-05-28 As per Rev F JLM
 IPP Rev:D 07-12-04 ECN 1072 DD verified by:JLM
 IPP Rev:E 08-09-08 ecn 08-510 DD verified by:EC IPP Rev:F
 11.11.01 as per DSI9517 REV.B DD verified by:EC IPP REV:G 16.05.02
 AS PER DWG REV.J DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN5C7A		Purchased	No			110	Each	147.0000	10	10			

AN5C7A

BOLT

**

Location	Loc Qty	Loc Code
FG	2	
19185	2	
FP001	67	
m131139	1	
m131320	32	
m132930	24	
m136450	10	
ST338	78	
m132123	10	
m136450	18	
m137507	50	

D3391-021

Manufactured No

110

Each

1.0000

1

1

D3391-021

Fwd Tube Assembly

**

Location	Loc Qty	Loc Code
FG039	1	
147918	1	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : ☐									

Picklist Print

Tuesday, May 23, 2017 10:55:30 AM

Page 2

Work Order ID: 161820

161820

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0532R

Purchased

No

110

Each

201.0000

10

10

NAS1149C0532R

**

WASHER

Location

Loc Qty

Loc Code

FP001

84

m135390

8

m136983

76

GA

42

116513

42

ST266

75

m136192

75

D3391-023

Manufactured

No

110

Each

0.0000

1

1

D3391-023

**

Mid Tube Assembly

D3391-025

Manufactured

No

110

Each

2.0000

1

1

D3391-025

**

Aft Tube Assembly

Location

Loc Qty

Loc Code

FG

1

147933

1

FG039

1

149928

1

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																						
Large Fab ☐	Composite ☐	Supplier ☐																																																																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																		
Description Work Order Deviation				Disposition				Completed By																																																																	
Root Cause				FAULT CATEGORY																																																																					
<table style="width:100%; border: none;"> <tr><td style="border: none;">Environment ☐</td><td style="border: none;">☐ No Re-verification</td></tr> <tr><td style="border: none;">Design ☐</td><td style="border: none;">☐ Operator</td></tr> <tr><td style="border: none;">Doc/Data ☐</td><td style="border: none;">☐ Offset/Setup</td></tr> <tr><td style="border: none;">Equip/Tooling ☐</td><td style="border: none;">☐ Supplier</td></tr> <tr><td style="border: none;">Handling/Pre ☐</td><td style="border: none;">☐ Training</td></tr> <tr><td style="border: none;">Material ☐</td><td style="border: none;">☐ Use for Testing</td></tr> <tr><td style="border: none;">Internal Transport ☐</td><td style="border: none;">☐ Poor Information</td></tr> <tr><td style="border: none;">Tribal Knowledge ☐</td><td style="border: none;">☐ Rushing</td></tr> <tr><td style="border: none;">LOA ☐</td><td style="border: none;">☐ Product Improvement</td></tr> <tr><td style="border: none;">Substation ☐</td><td style="border: none;">☐ Process Improvement</td></tr> <tr><td style="border: none;">Past Expiry Date ☐</td><td style="border: none;">☐ Manufacturing Process</td></tr> <tr><td style="border: none;">Misidentified ☐</td><td style="border: none;">☐ Past Due</td></tr> </table>				Environment ☐	☐ No Re-verification	Design ☐	☐ Operator	Doc/Data ☐	☐ Offset/Setup	Equip/Tooling ☐	☐ Supplier	Handling/Pre ☐	☐ Training	Material ☐	☐ Use for Testing	Internal Transport ☐	☐ Poor Information	Tribal Knowledge ☐	☐ Rushing	LOA ☐	☐ Product Improvement	Substation ☐	☐ Process Improvement	Past Expiry Date ☐	☐ Manufacturing Process	Misidentified ☐	☐ Past Due	<table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Pressure/Forced</td><td style="border: none;">☐ Temperature/Cure</td><td style="border: none;">☐ Power Loss/Surge</td><td style="border: none;">☐ Positioned Wrong</td></tr> <tr><td style="border: none;">☐ Bending</td><td style="border: none;">☐ Set-up</td><td style="border: none;">☐ Folio/Program</td><td style="border: none;">☐ Outside Dimensions</td></tr> <tr><td style="border: none;">☐ Centre Not Concentric</td><td style="border: none;">☐ BOM/Route</td><td style="border: none;">☐ Grain</td><td style="border: none;">☐ Over/Under tolerance</td></tr> <tr><td style="border: none;">☐ Cracks</td><td style="border: none;">☐ Broken/Damage/Defect</td><td style="border: none;">☐ Weld</td><td style="border: none;">☐ Part Incorrect</td></tr> <tr><td style="border: none;">☐ Crimp/Kink/Ripple/Wave</td><td style="border: none;">☐ Inspection Incomplete/Unqualified</td><td style="border: none;">☐ Wrong Stock Pulled</td><td style="border: none;">☐ Part Lost/Missing</td></tr> <tr><td style="border: none;">☐ Cuffs</td><td style="border: none;">☐ Contamination</td><td style="border: none;">☐ Out of Sequence</td><td style="border: none;">☐ Part Moved</td></tr> <tr><td style="border: none;">☐ Crushing</td><td style="border: none;">☐ Countersink</td><td style="border: none;">☐ Off-set</td><td style="border: none;">☐ Drawing</td></tr> <tr><td style="border: none;">☐ Heat Treat</td><td style="border: none;">☐ Cut Too Short</td><td style="border: none;">☐ Mislabeled</td><td style="border: none;">☐ Finish</td></tr> <tr><td style="border: none;">☐ Wave/Twist in Tube</td><td style="border: none;">☐ Instructions Incomplete/Unclear</td><td style="border: none;">☐ Fit/Function</td><td style="border: none;">☐ Misread</td></tr> <tr><td style="border: none;">☐ Marks/Chatter</td><td style="border: none;">☐ Drill Holes</td><td style="border: none;">☐ Misaligned/off center</td><td style="border: none;">☐ Turning Sequence</td></tr> </table>						☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence
Environment ☐	☐ No Re-verification																																																																								
Design ☐	☐ Operator																																																																								
Doc/Data ☐	☐ Offset/Setup																																																																								
Equip/Tooling ☐	☐ Supplier																																																																								
Handling/Pre ☐	☐ Training																																																																								
Material ☐	☐ Use for Testing																																																																								
Internal Transport ☐	☐ Poor Information																																																																								
Tribal Knowledge ☐	☐ Rushing																																																																								
LOA ☐	☐ Product Improvement																																																																								
Substation ☐	☐ Process Improvement																																																																								
Past Expiry Date ☐	☐ Manufacturing Process																																																																								
Misidentified ☐	☐ Past Due																																																																								
☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong																																																																						
☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions																																																																						
☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance																																																																						
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect																																																																						
☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																																																						
☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved																																																																						
☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing																																																																						
☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish																																																																						
☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread																																																																						
☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence																																																																						
☐ OTHER : _____																																																																									

Picklist Print

Tuesday, May 23, 2017 10:55:30 AM

Page 3

Work Order ID: 161820

161820

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C4A Purchased No 110 Each 1,226.000 24 24

AN3C4A

Bolt

**

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	20	
122814	20	
FP001	771	
M136450	23	
M136740	8	
M136986	20	
M137075	43	
M137164	2	
M137361	675	
OVER002	400	
M137507	150	
M137587	250	
ST350	35	
M135704	35	

AN3C6A Purchased No 110 Each 219.0000 4 4

AN3C6A

Bolt

**

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	10	
122416	10	
FP001	4	
m136295	4	
OVER002	185	
m136781	85	
m137361	100	
ST350	20	
m128704	18	
m132767	2	

Tuesday, May 23, 2017 10:55:30 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
☐ OTHER : _____									

Picklist Print

Tuesday, May 23, 2017 10:55:30 AM

Page 4

Work Order ID: 161820

161820

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

110

Each

5,191.000

28

28

NAS1149C0332R******

WASHER

LocationLoc QtyLoc Code

FP001

2350

m136741

46

m137381

2304

GA

514

m133284

22

m136444

492

ST260a

2200

m135408

0

m135908

200

m136741

0

m137597

2000

ST266

127

m136643

127

D4095-041

Manufactured

No

110

Each

9.0000

1

1

D4095-041******

Wearplate Fwd

LocationLoc QtyLoc Code

FP002

9

149218

3

156390

2

159367

4

D4095-043

Manufactured

No

110

Each

6.0000

1

1

D4095-043******

Wearplate Aft

LocationLoc QtyLoc Code

FP002

6

158921

6

Tuesday, May 23, 2017 10:55:30 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Picklist Print

Tuesday, May 23, 2017 10:55:30 AM

Page 5

Work Order ID: 161820

161820

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

D4095-045

Manufactured No

110

Each

11.0000

1

1

D4095-045

Wearplate Center

Location

Loc Qty

Loc Code

FP002

11

149289

1

154305

6

159875

4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X		D3391-041	FLOAT SKIDTUBE ASSEMBLY
	X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
2	2	D3591-1	BUSHING
4		D3672-3	WASHER
1	1	D4095-041	WEARSHOE
1	1	D4095-043	WEARSHOE
1	1	D4095-045	WEARSHOE
1	1	D4095-047	WEARPAD
1	1	D4095-049	WEARPAD
1	1	D4095-051	WEARSHOE
24	24	AN3C4A	BOLT
4	4	AN3C6A	BOLT
10	10	AN5C7A	BOLT
28	28	NAS1149C0332R	WASHER
10	10	NAS1149C0532R	WASHER
4		MS27039C4-12	SCREW
4		NAS1149C0432R	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 161820

MAY 23 2017

J	INCORPORATED DSI 9733, REFORMAT DRAWING CHANGED CBORE DEPTH (ZN D2-8, D2-9), REVISED TABLES, REPLACED POWDER COAT WITH PAINT	ML	16.01.14
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B8-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B8-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	08.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	08.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	DP	D3391	SHEET 1 OF 11
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

RELEASED
2016-04-28
EON 16-96

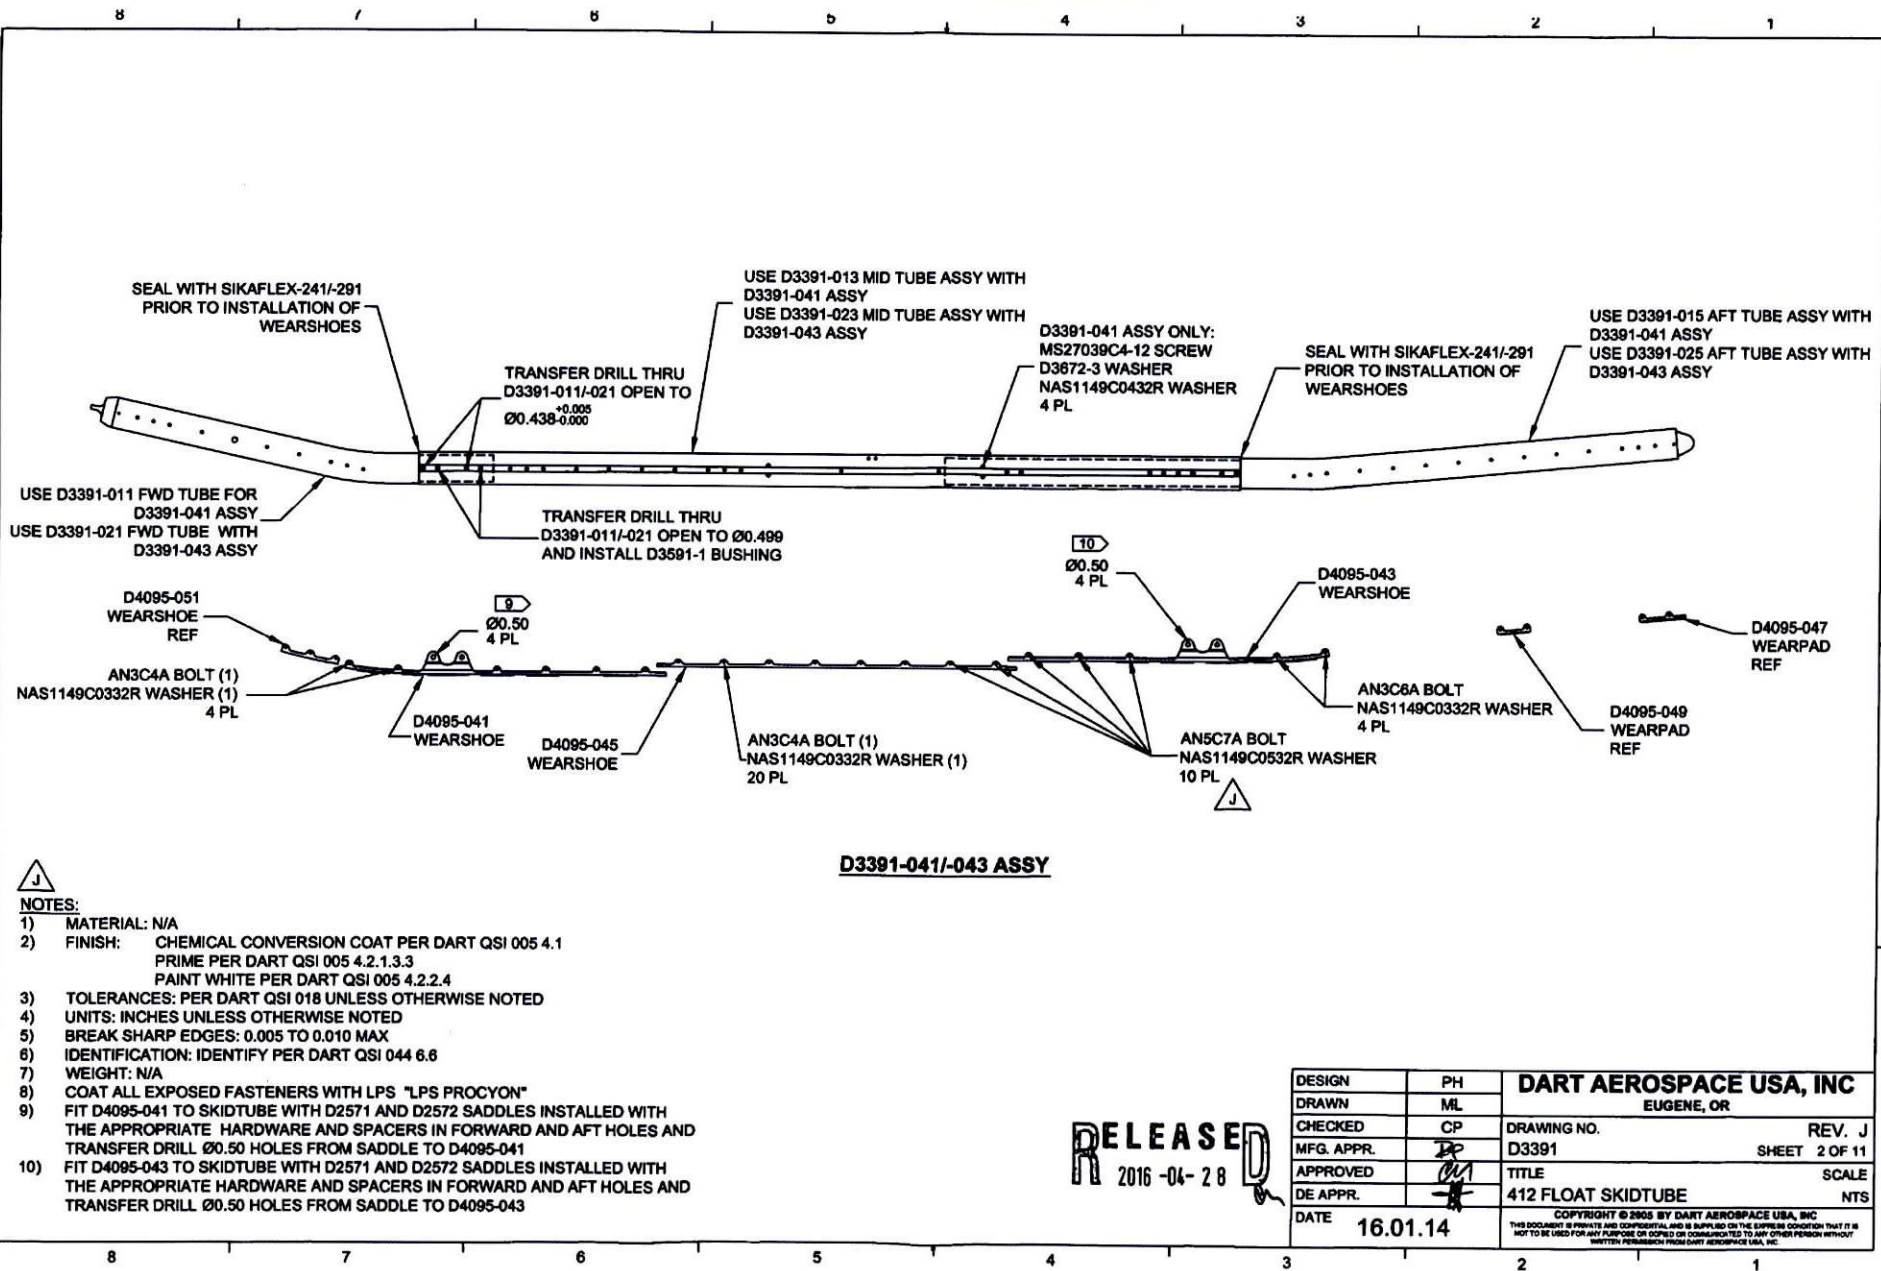


D3391-041/-043 ASSY

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME PER DART QSI 005 4.2.1.3.3
PAINT WHITE PER DART QSI 005 4.2.2.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY PER DART QSI 044 6.6
- 7) WEIGHT: N/A
- 8) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 9) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 10) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
R 2016-04-28


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	DP	D3391	SHEET 2 OF 11
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

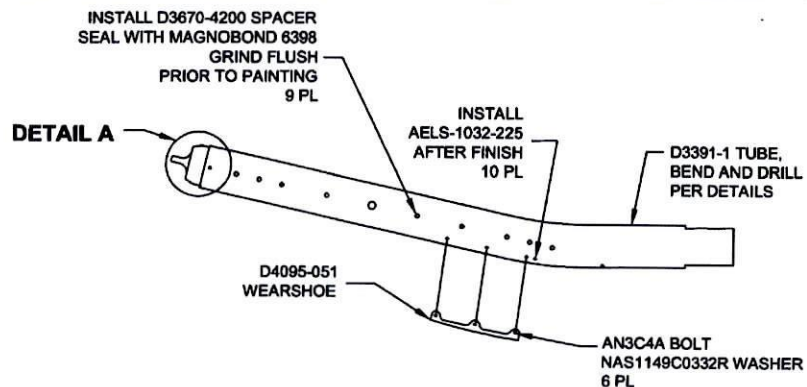


D3391-011 FWD TUBE ASSEMBLY
ASSEMBLY DETAIL

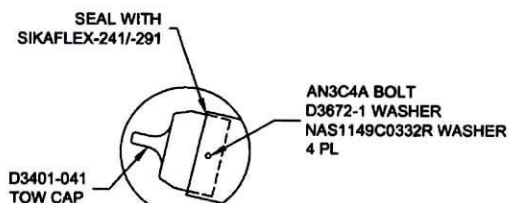

DETAIL A
SCALE 2X

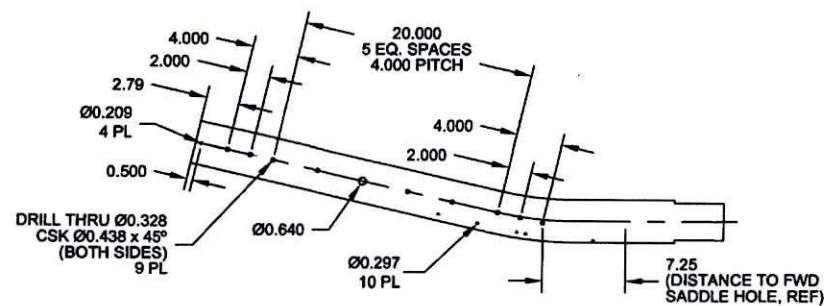

D3391-011 DRILLING DETAIL

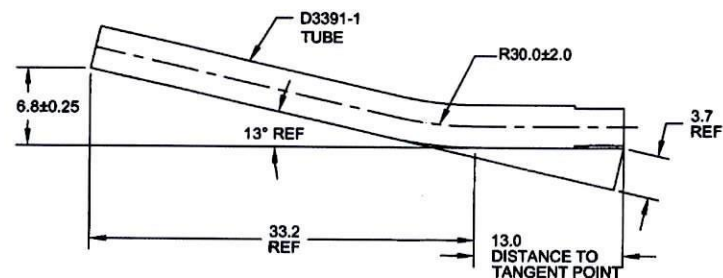

D3391-011 BENDING DETAIL
(MAKE FROM D3391-1)

D3391-011 FWD TUBE ASSEMBLY PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
X	D3391-011	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
9	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	Pe	D3391	SHEET 3 OF 11
APPROVED	By	TITLE	SCALE
DE APPR.	W	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

RELEASED
2016-04-28

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

DETAIL B



INSTALL
AELS-1032-225
AFTER FINISH
10 PL

D4095-051
WEARSHOE

AN3C4A BOLT
NAS1149C0332R WASHER
6 PL

D3391-021 FWD TUBE ASSEMBLY ASSEMBLY DETAIL

SEAL WITH
SIKAFLEX-241/-291




AN3C4A BOLT
D3672-1 WASHER
NAS1149C0332R WASHER
4 PL

D3401-041
TOW CAP


DETAIL B SCALE 2X

D3391-021 FWD TUBE ASSEMBLY PARTS LIST

QTY -021	PART NUMBER	DESCRIPTION
X	D3391-021	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
4	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

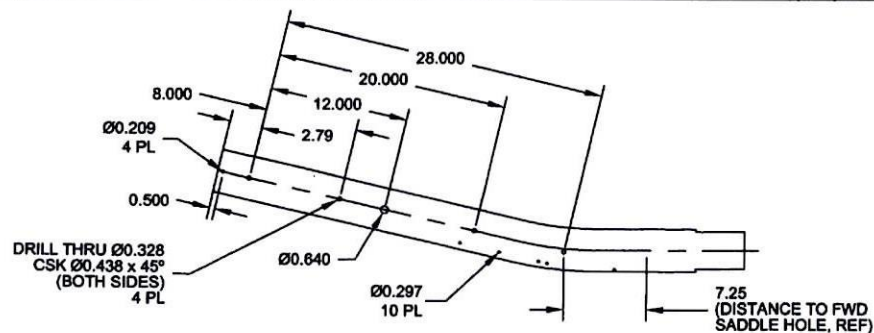


D3391-021 DRILLING DETAIL

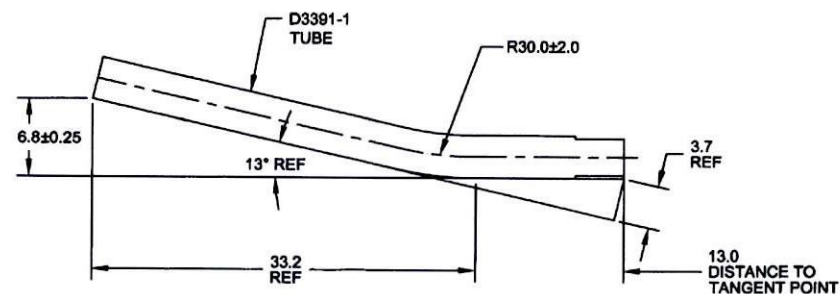


D3391-021 BENDING DETAIL (MAKE FROM D3391-1)

RELEASED
2016-04-28


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	DP	D3391	SHEET 4 OF 11
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

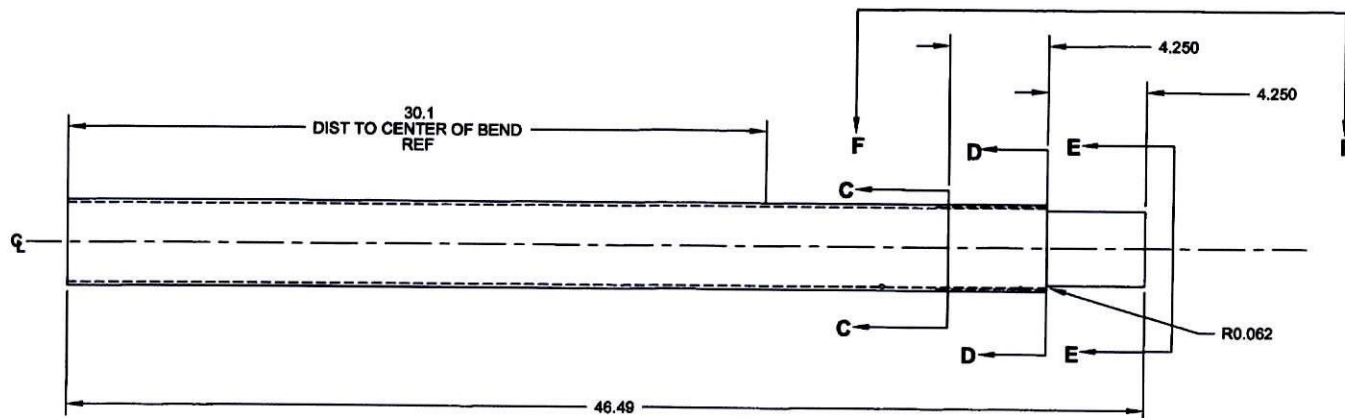


D3391-1 TUBE
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

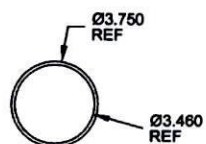


SECTION C-C

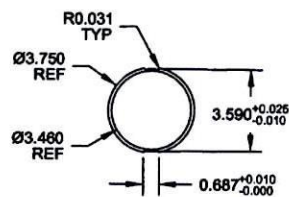

SECTION D-D

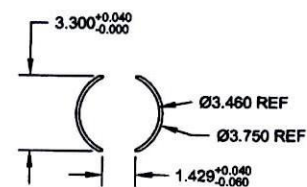


SECTION E-E

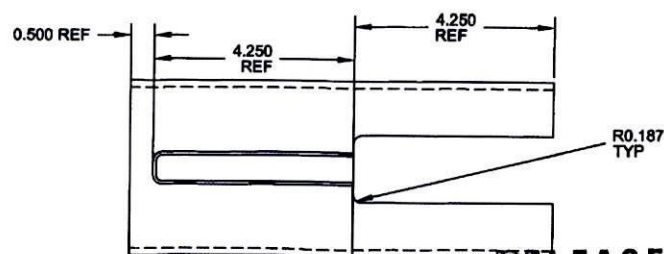


VIEW F-F
SCALE 2X


RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	22	D3391	SHEET 5 OF 11
APPROVED	11	TITLE	SCALE
DE APPR.	11	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

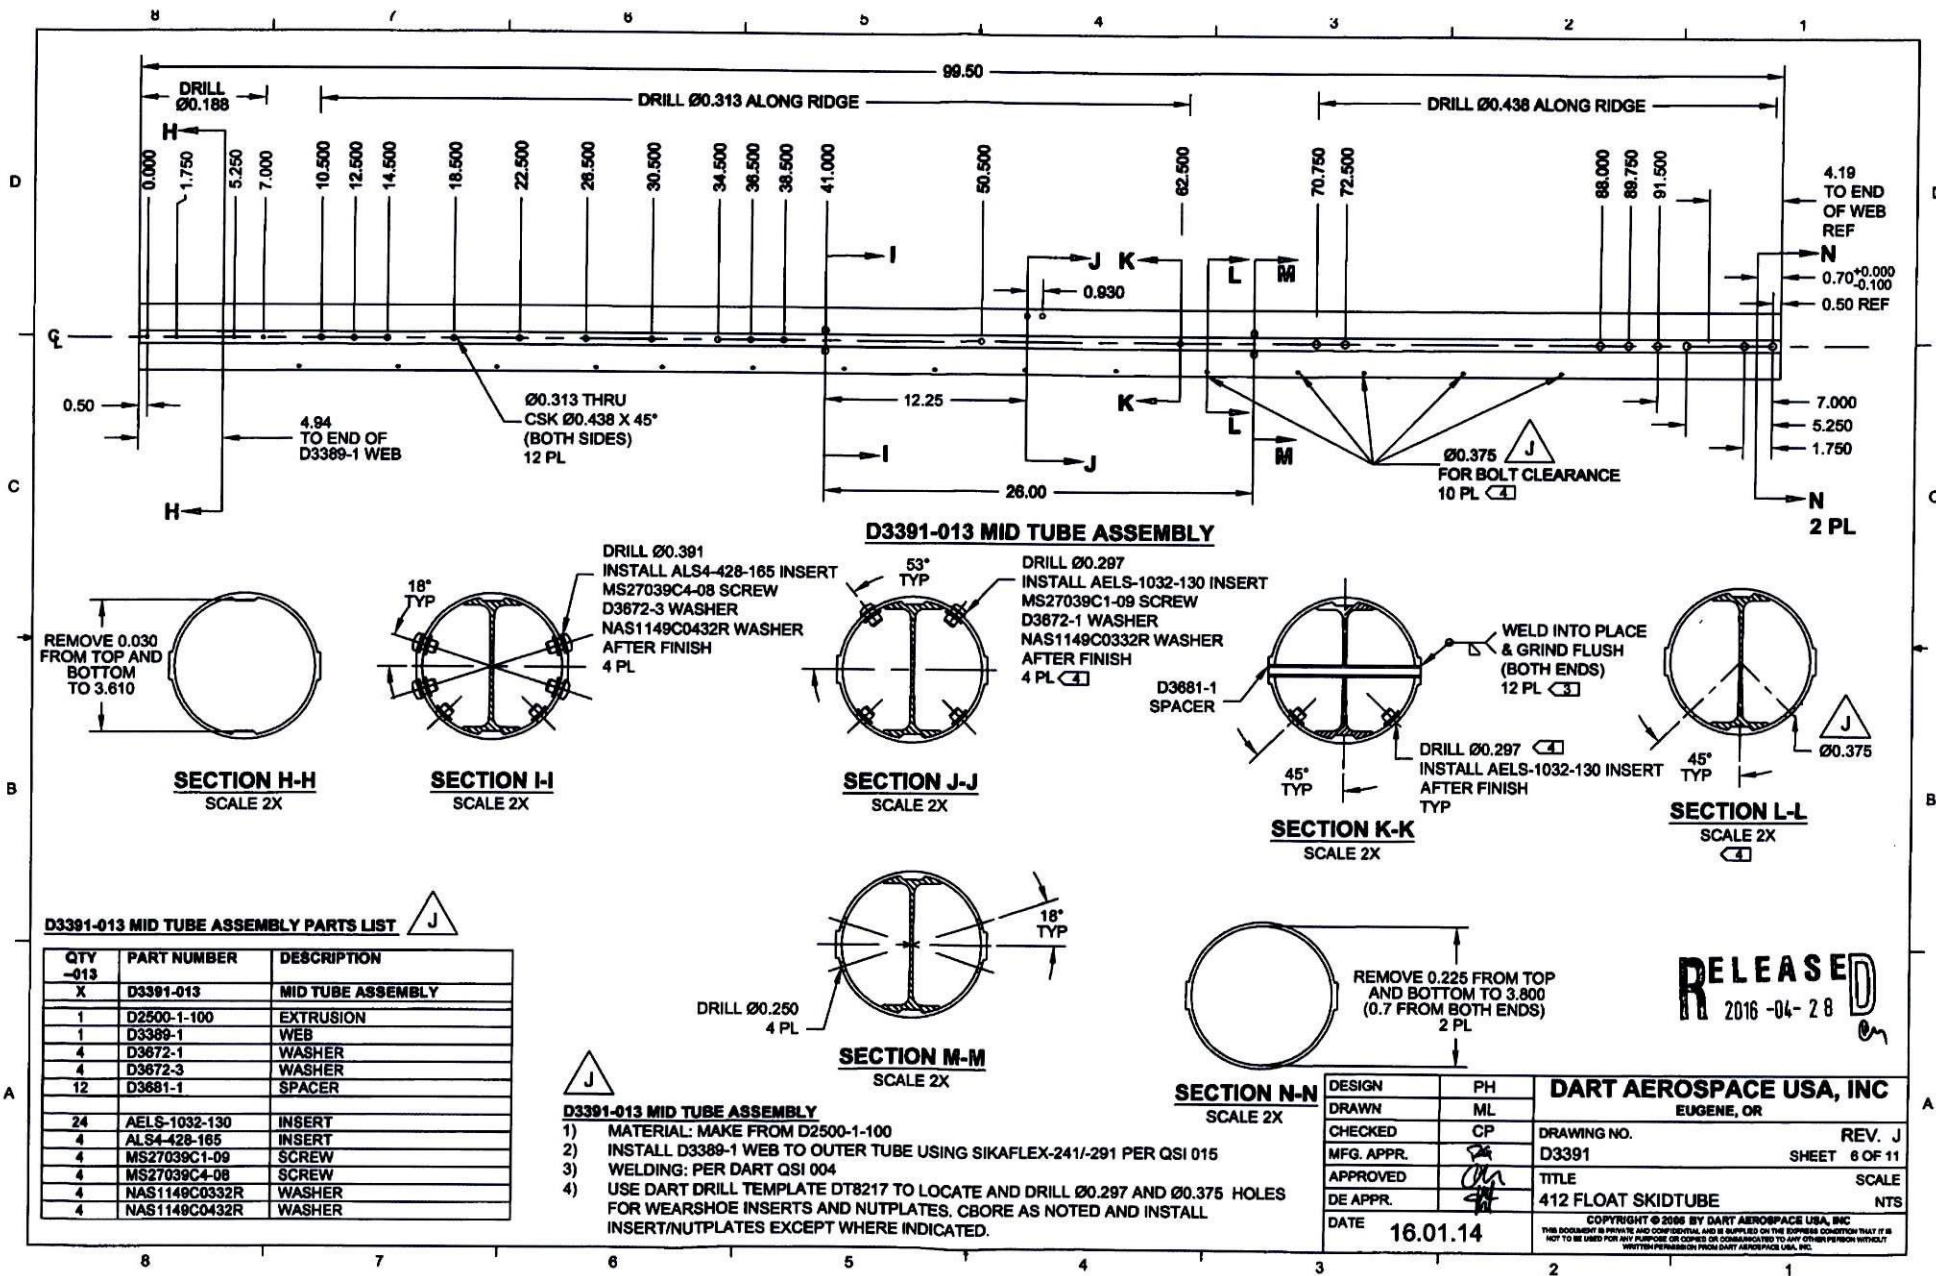


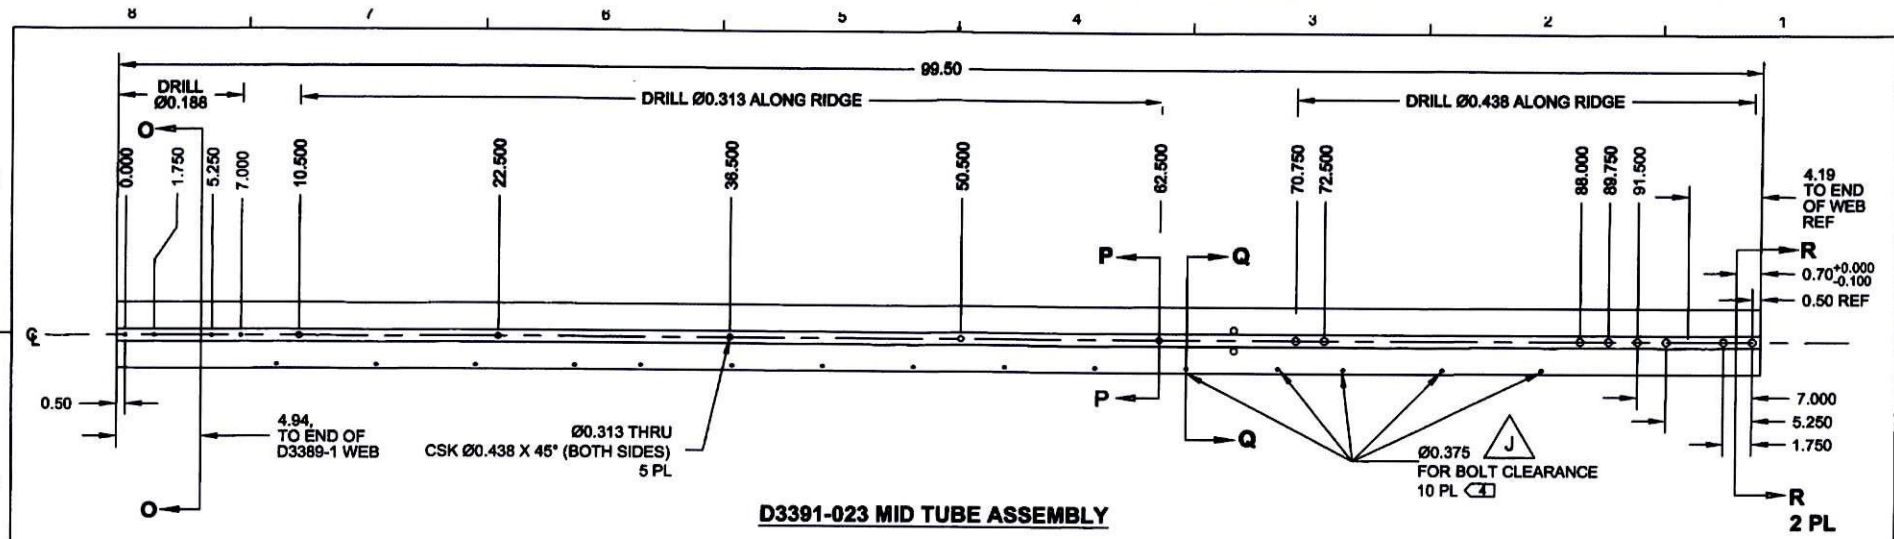


D3391-023 MID TUBE ASSEMBLY

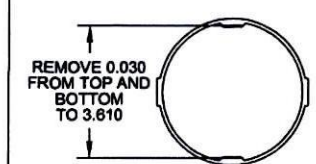


SECTION O-O
SCALE 2X

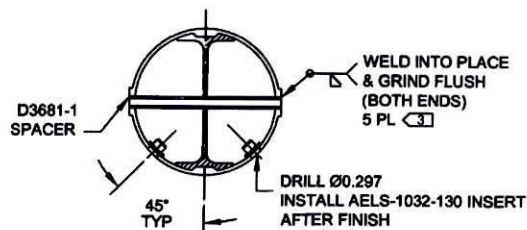

SECTION P-P
SCALE 2X

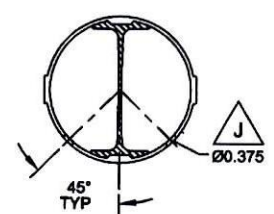

SECTION Q-Q
SCALE 2X

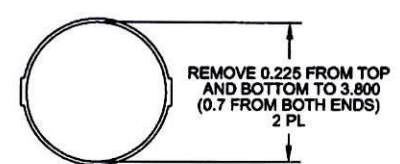

SECTION R-R
SCALE 2X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-023		
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT





D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES, CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

RELEASED
2016-04-28

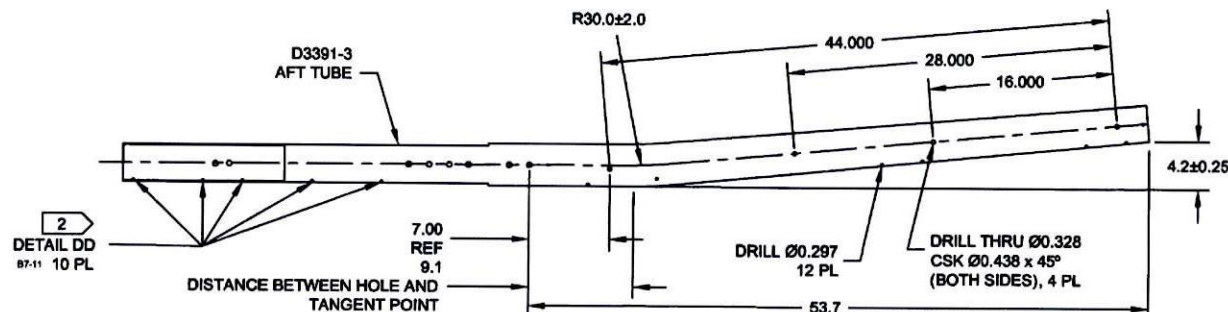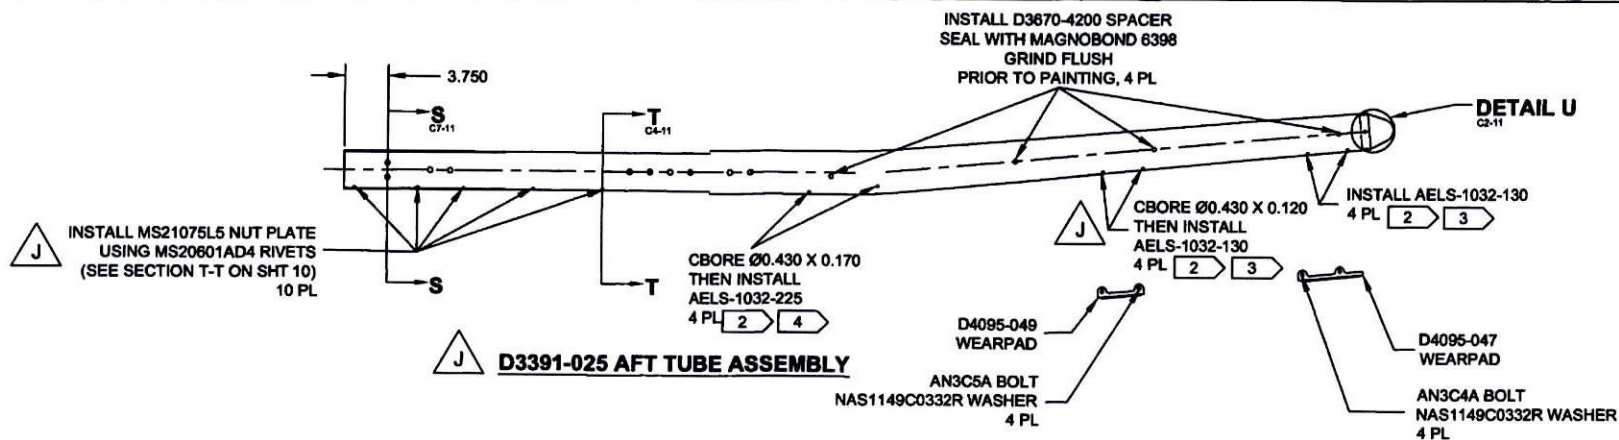

D3391-025 AFT TUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-025	AFT TUBE ASSEMBLY
1	D2646	AFT CAP
1	D3391-3	AFT TUBE
4	D3670-4200	SPACER
2	D3672-1	WASHER
1	D4095-049	WEARPAD
1	D4095-047	WEARPAD
6	AELS-1032-130	INSERT
4	AELS-1032-225	INSERT
6	AN3C4A	BOLT
4	AN3C5A	BOLT
20	MS20801AD4	RIVET, BLIND
10	MS21075L5	NUT PLATE FLOATING
10	NAS1149C0332R	WASHER

NOTES:


- 1) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 2) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED. USE NUT PLATE DRILL JIG IF REQUIRED.
- 3) ENSURE WALL THICKNESS IS BETWEEN 0.070 AND 0.130 BEFORE INSTALLING INSERT
- 4) ENSURE WALL THICKNESS IS BETWEEN 0.130 AND 0.225 BEFORE INSTALLING INSERT

RELEASED
2016-04-28


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV.
MFG. APPR.	<i>CP</i>	D3391	SHEET 9 OF 1
APPROVED	<i>ML</i>	TITLE	SCALE
DE APPR.	<i>ML</i>	AFT TUBE ASSEMBLY	NT
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

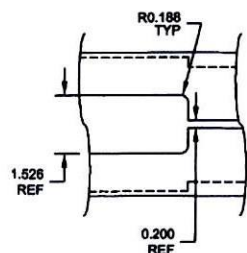


VIEW W-W
SCALE 4X

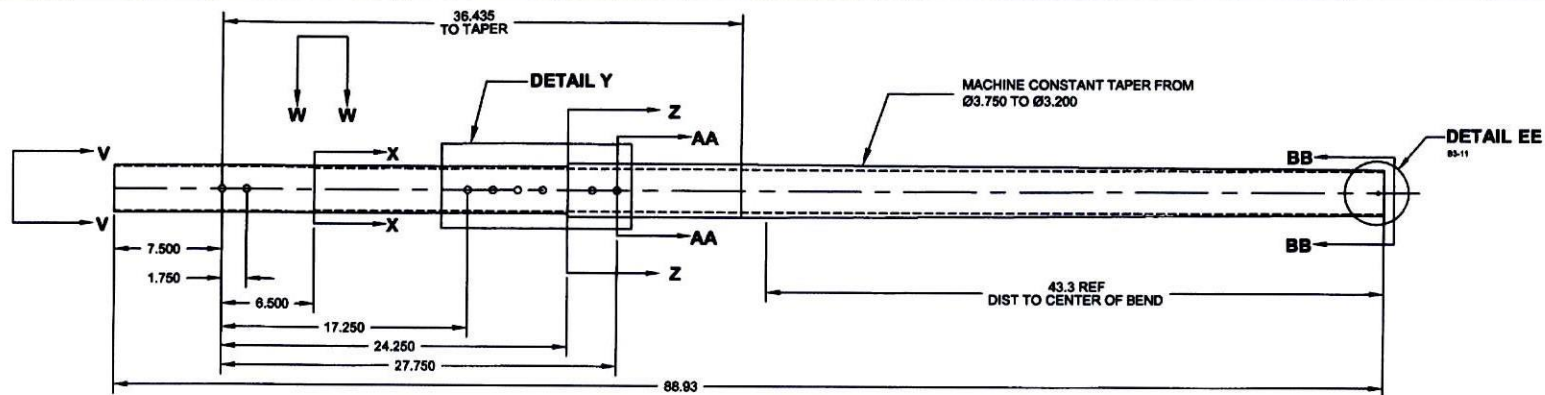


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090)

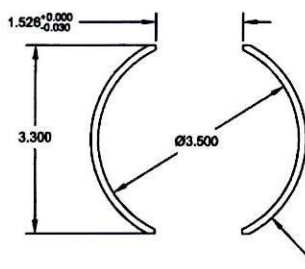


SECTION V-V
SCALE 4X

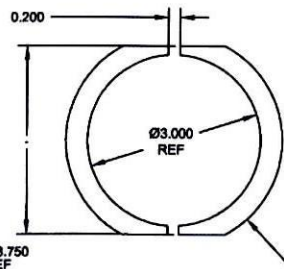


SECTION X-X
SCALE 4X

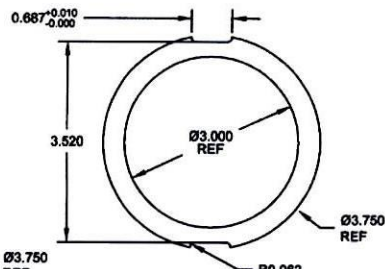


SECTION Z-Z
SCALE 4X

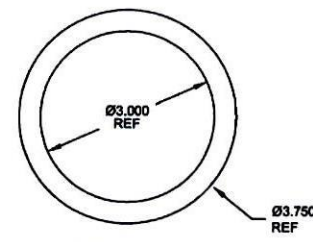


SECTION AA-AA
SCALE 4X

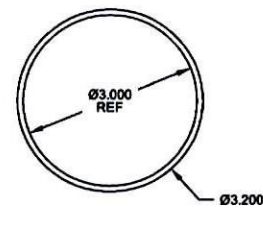

SECTION BB-BB
SCALE 4X

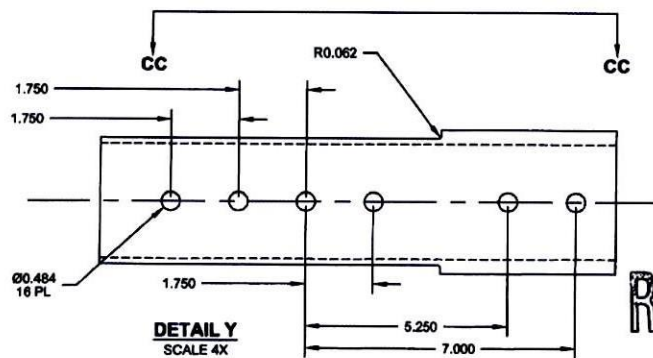


DETAIL Y
SCALE 4X

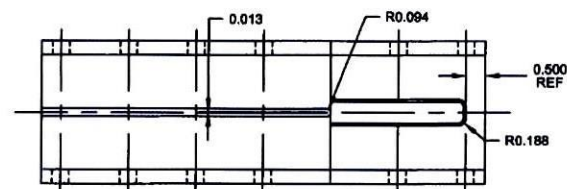

VIEW CC-CC

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 10 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

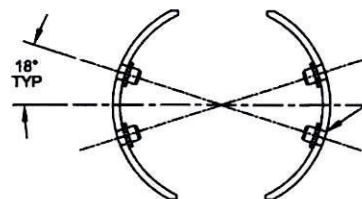


SECTION S-S
SCALE 5X


DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

USE DT8217 DRILL TEMPLATE
TO LOCATE HOLES AND OPEN
TO Ø0.375


MS21075L5 NUTPLATE
REF

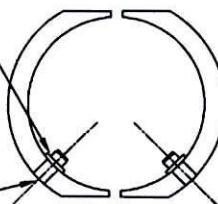

SECTION T-T
SCALE 5X
5 PL

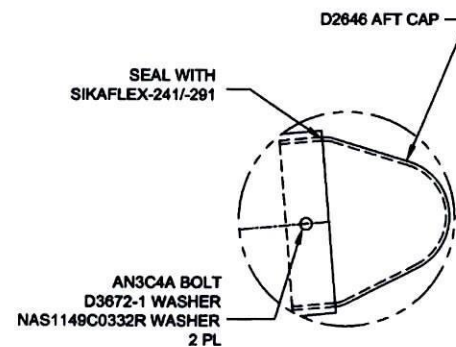


DETAIL U
SCALE 5X

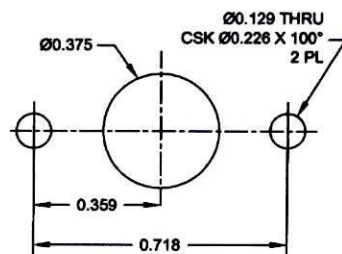

DRILLING DETAIL DD
SCALE 10X



1

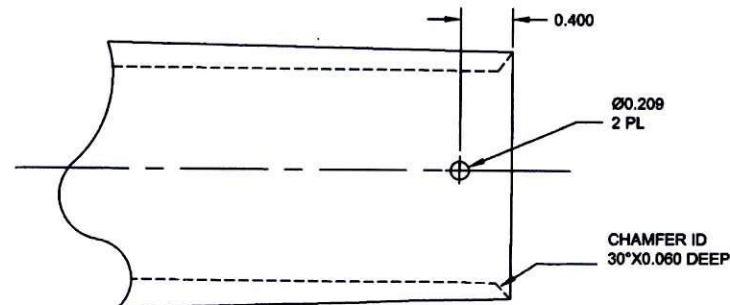

DETAIL EE
SCALE 2X



RELEASED
2016-04-28

NOTES:
1) USE INDUSTRY STANDARD NUT PLATE DRILL JIG IF REQUIRED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 11 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	